



Avaya Solution & Interoperability Test Lab

Application Notes for Configuring Avaya IP Office Release 9.0 to support BT Global Services NOAS SIP Trunk – Issue 1.0

Abstract

These Application Notes describe the procedures for configuring Session Initiation Protocol (SIP) trunking between BT Global Services NOAS SIP Trunk service and Avaya IP Office.

The BT NOAS SIP Trunk Service provides PSTN access via a SIP trunk connected to the BT NOAS Voice Over Internet Protocol (VoIP) network as an alternative to legacy Analogue or Digital trunks. BT is a member of the Avaya DevConnect Service Provider program.

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

1. Introduction

These Application Notes describe the procedures for configuring Session Initiation Protocol (SIP) trunking between BT SIP Trunk service and Avaya IP Office. Customers using this Avaya SIP-enabled enterprise solution with BT NOAS SIP Trunk are able to place and receive PSTN calls via a dedicated Internet connection and the SIP protocol. This converged network solution is an alternative to traditional PSTN trunks. This approach generally results in lower cost for the enterprise customer.

2. General Test Approach and Test Results

The general test approach was to configure a simulated enterprise site using Avaya IP Office to connect to the BT NOAS SIP Trunk Service. This configuration (shown in **Figure 1**) was used to exercise the features and functionality listed in **Section 2.1**.

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution.

2.1. Interoperability Compliance Testing

To verify SIP trunking interoperability the following features and functionality were exercised during the interoperability compliance test:

- Incoming calls to the enterprise site from PSTN phones using the SIP Trunk provided by BT, calls made to SIP and H.323 telephones at the enterprise
- Outgoing calls from the enterprise site completed via BT NOAS SIP trunk to PSTN destinations, calls made from SIP and H.323 telephones
- Calls using the G.711A, G.711MU and G.729A codecs
- Fax calls to/from a group 3 fax machine to a PSTN connected fax machine using T.38
- DTMF transmission using RFC 2833 with successful Voice Mail/Vector navigation for inbound and outbound calls
- Inbound and outbound PSTN calls to/from an IP Office Softphone clients
- Various call types including: local, long distance, international, toll free (outbound) and directory assistance
- Caller ID presentation and Caller ID restriction
- Voicemail navigation for inbound and outbound calls
- User features such as hold and resume, transfer, and conference
- Off-net call forwarding and twinning
- Transmission and response of SIP OPTIONS messages sent by BT requiring Avaya response and sent by Avaya requiring BT response

2.2. Test Results

Interoperability testing of the sample configuration was completed with successful results for BT NOAS SIP Trunk Service with the following observations:

- During compliance testing it was observed that when BT NOAS initiates a call-hold, BT NOAS will send a reINVITE with the attribute “SendOnly” in the SDP. IP Office correctly responds with 200OK with the attribute “RecvOnly” in the SDP. However, once call-hold is initiated, RTCP packets are just sent in one direction from BT NOAS to Avaya IP Office. IP Office does not send RTCP packets when BT NOAS initiated call-hold using the Media attribute “SendOnly” in the SDP. BT NOAS expect to receive RTCP from IP Office and have 25 second RTCP timers configured on their SIP Media Gateway. As BT NOAS don’t receive any RTCP packets from IP Office, after 25 seconds, BT NOAS issue a BYE and the call is torn down. An Avaya IP Office MR was opened on this issue and a fix has been provided in a custom build **IP Office 9.0.110.1**. With this build, it requires the configuration of a **NoUserSourceNumber** on IP Office. The details and configuration of the **NoUserSourceNumber** are outlined in **Section 5.10**. During testing, IP Office 9.0FP was used for testing with custom build **IP Office 9.0.110.1** applied as a release-specific patch. **IP Office 9.0.110.1** will be incorporated in feature pack **IP Office 9.0.4** later this year. Versions of IP Office prior to the release of **IP Office 9.0.4** will require the release specific patch **IP Office 9.0.110.1** to address this issue.
- Inbound call hold and resume from PSTN was not tested as PSTN was unable to initiate the call-hold due to their environment set-up.
- PSTN called party hang-up during an active call did not cause the call to drop. Avaya IP Office caller must hang-up first, or wait for the PSTN T2ISUP timer to expire.
- No inbound toll free numbers were tested, however routing of inbound DDI numbers and the relevant number translation was successfully tested.
- Access to Emergency Services was not tested as no test call had been booked with the Emergency Services Operator.

2.3. Support

For technical support on the Avaya products described in these Application Notes visit <http://support.avaya.com>.

For technical support on BT products please use the following web link. <http://btbusiness.custhelp.com/app/contact>

3. Reference Configuration

Figure 1 illustrates the test configuration. The test configuration shows an enterprise site connected to BT NOAS SIP Trunk service. Located at the enterprise site is an Avaya IP Office 500 v2. Endpoints include two Avaya 1600 Series IP Telephones (with H.323 firmware), one Avaya 1140e SIP Telephone, Avaya 2420 Digital Telephone, Avaya Analogue Telephone and fax machine. The site also has a Windows XP PC running Avaya IP Office Manager to configure the Avaya IP Office as well as an IP Office Softphone client and Flare Experience for Windows for mobility testing. For security purposes, any public IP addresses or PSTN routable phone numbers used in the compliance test are not shown in these Application Notes. Instead, public IP addresses have been changed to a private format and all phone numbers have been obscured beyond the city code.

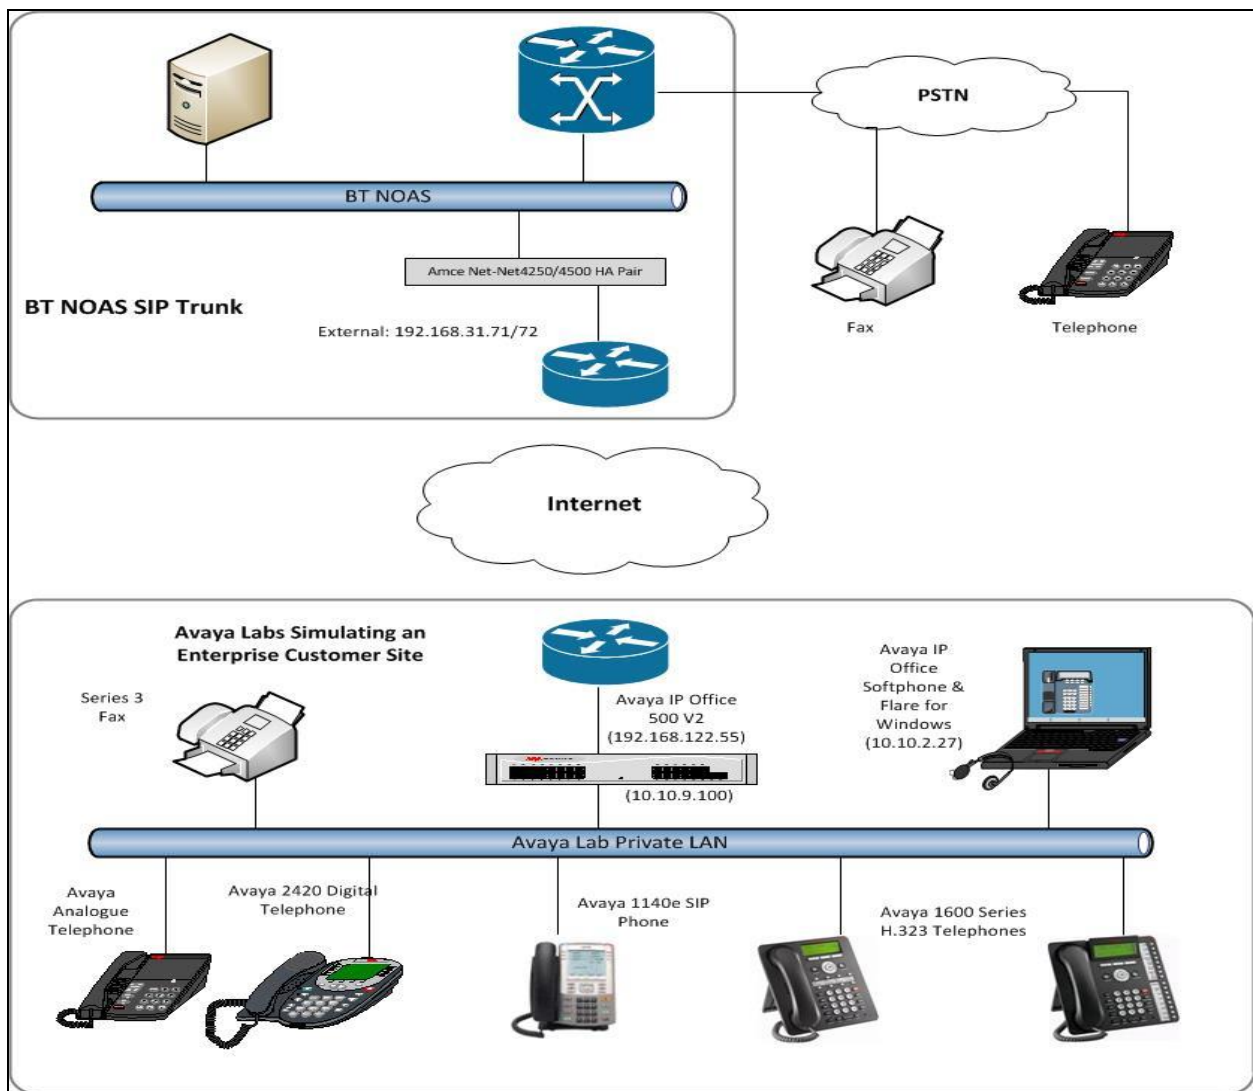


Figure 1: Test Setup BT NOAS SIP Trunk Service to Simulated Enterprise

Avaya IP Office was configured to connect to a static IP address at the Service Provider. For the purposes of the compliance test, users dialed a short code of 9N digits to send digits across the SIP trunk to the BT network. The short code of 9 is stripped off by Avaya IP Office and the remaining N digits sent.

In an actual customer configuration, the enterprise site may also include additional network components between the Service Provider and Avaya IP Office such as a Session Border Controller or data firewall. A complete discussion of the configuration of these devices is beyond the scope of these Application Notes. However, it should be noted that SIP and RTP traffic between the Service Provider and Avaya IP Office must be allowed to pass through these devices. BT sends SIP signalling from one IP address, however RTP traffic may originate from a different IP address and ports which may vary from customer to customer. Customers will need to work with BT to determine the proper IP addresses and ports that require access to their network.

4. Equipment and Software Validated

The following equipment and software were used for the sample configuration provided:

Equipment/Software	Release/Version
Avaya	
Avaya IP Office 500 V2	Avaya IP Office R9.0 with release-specific patch. IP Office 9.0.110.1
Avaya 1603 Phone (H.323)	1.3100
Avaya 1608 Phone (H.323)	1.3100
Avaya SoftPhone (SIP)	3.056516
Avaya Flare Experience for Windows (SIP)	1.1.3.14
Avaya 1140e (SIP)	FW: 04.01.13.00.bin
Avaya 2420 Digital Phone	R6.0
Avaya 98390 Analogue Phone	N/A
BT NOAS	
Acme Packet Net-Net 4250 Session border Controller	SC6.1.0 MR-11 patch 1 (build 1036)


5. Configure Avaya IP Office

This section describes the Avaya IP Office configuration to support connectivity to BT NOAS SIP Trunk service. Avaya IP Office is configured through the Avaya IP Office Manager PC application. From a PC running the Avaya IP Office Manager application, select **Start → Programs → IP Office → Manager** to launch the application. Navigate to **File → Open Configuration**, select the proper Avaya IP Office system from the pop-up window, and log in with the appropriate credentials. A management window will appear similar to the one in the next section. All the Avaya IP Office configurable components are shown in the left pane known as the Navigation Pane. The pane on the right is the Details Pane. These panes will be referenced

throughout the Avaya IP Office configuration. All licensing and feature configuration that is not directly related to the interface with the Service Provider (such as twinning) is assumed to already be in place.


5.1. Verify System Capacity

Navigate to **License** → **SIP Trunk Channels** in the Navigation Pane. In the Details Pane verify that the **License Status** is Valid and that the number of **Instances** is sufficient to support the number of SIP trunk channels provisioned by BT.

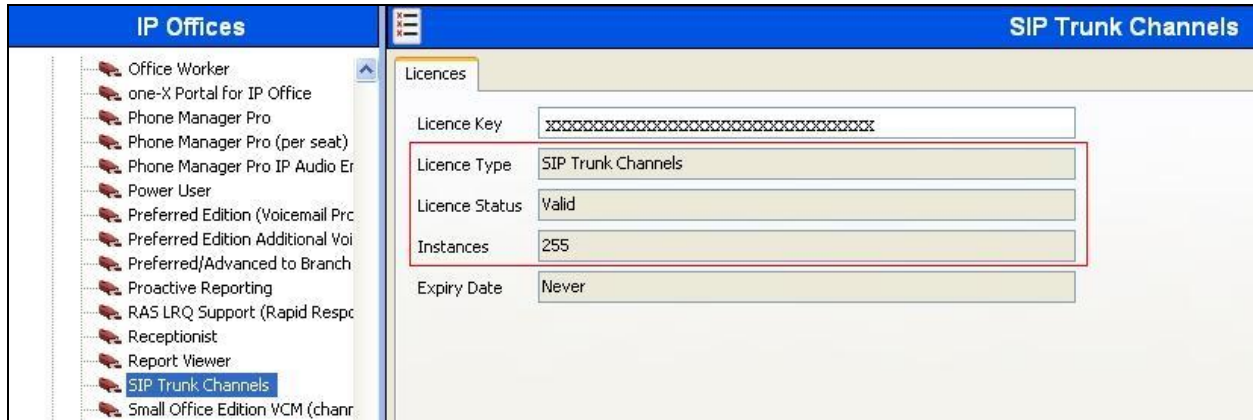

5.2. LAN2 Settings

In the sample configuration, the LAN2 port was used to connect the Avaya IP Office to the external internet. To access the LAN2 settings, first navigate to **System** → **GSSCP_IPO2** in the Navigation Pane where GSSCP_IPO2 is the name of the IP Office. Navigate to the **LAN2** → **LAN Settings** tab in the Details Pane. The **IP Address** and **IP Mask** fields are the public interface of the IP Office. All other parameters should be set according to customer requirements. On completion, click the **OK** button (not shown).

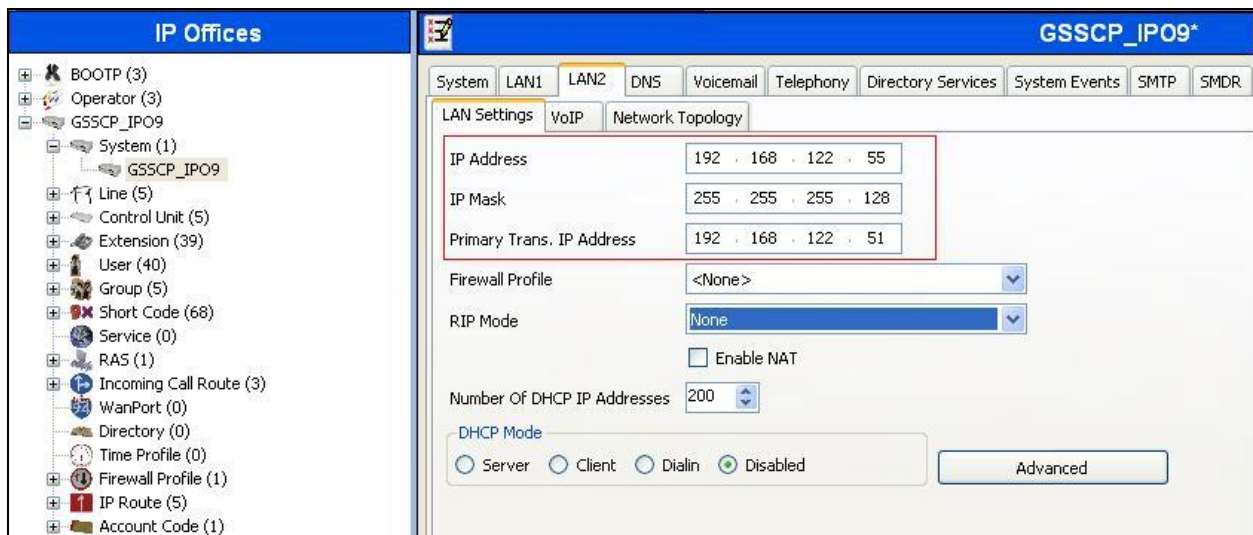


On the **VoIP** tab in the Details Pane, check the **SIP Trunks Enable** box to enable the configuration of SIP trunks. The IP Office Softphone uses SIP. If Softphone along with any other SIP endpoint is to be used, the **SIP Registrar Enable** box must also be checked. The **RTP Port Number Range** can be customized to a specific range of receive ports for RTP media. Based on this setting, Avaya IP Office would request RTP media be sent to a UDP port in the configurable range for calls using LAN2.

Avaya IP Office can also be configured to mark the Differentiated Services Code Point (DSCP) in the IP Header with specific values to support Quality of Services policies for both signalling and media. The **DSCP** field is the value used for media and the **SIG DSCP** is the value used for signalling. The specific values used for the compliance test are shown in the example below. All other parameters should be set according to customer requirements. On completion, click the **OK** button (not shown).

The screenshot displays the configuration interface for GSSCP_IP09*. The 'VoIP' tab is selected under the 'LAN2' section. The 'SIP Trunks Enable' and 'SIP Registrar Enable' checkboxes are checked and highlighted with a red box. The 'Domain Name' is set to 'avaya.com'. Under 'Layer 4 Protocol', 'UDP' and 'TCP' are checked, with their respective ports (5060) and remote ports (5060) shown. 'TLS' is unchecked, with its port (5061) and remote port (5061) also shown. The 'Challenge Expiry Time (secs)' is set to 10. The 'RTP' section shows a 'Port Number Range' with a 'Minimum' of 49152 and a 'Maximum' of 64566, both highlighted with a red box.

Select the **Network Topology** tab as shown in the following screen. In the sample configuration, the default settings were used and the **Use Network Topology Info** in the **SIP Line** was set to “None” in **Section 5.6**. It is important that the **Binding Refresh Time** is set to the correct value. Avaya IP Office sends SIP OPTIONS messages periodically to determine if the SIP connection is active. Below is a sample configuration. On completion, click the **OK** button (not shown).

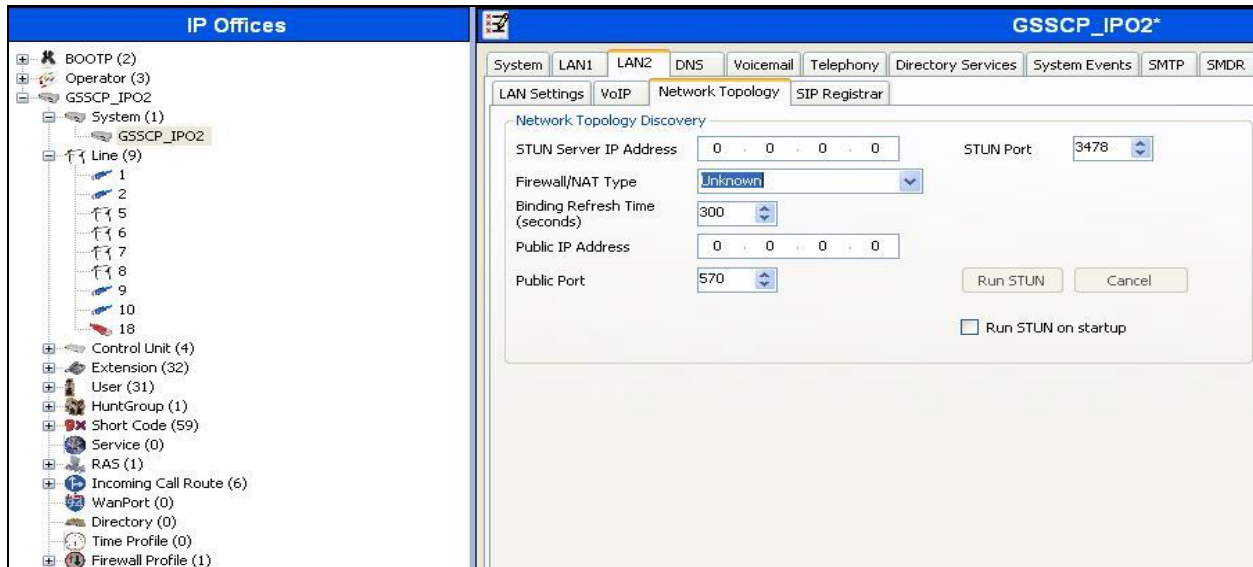


5.3. System Telephony Settings

Navigate to the **Telephony** → **Telephony** tab on the Details Pane. Choose the **Companding Law** typical for the enterprise location. For Europe, **ALAW** is used. Uncheck the **Inhibit Off-Switch Forward/Transfer** box to allow call forwarding and call transfer to the PSTN via the Service Provider across the SIP trunk. On completion, click the **OK** button (not shown).




5.4. System Twinning Settings

Navigate to the **Twining** tab, check the box labeled **Send original calling party information for Mobile Twinning**. With this setting, Avaya IP Office will send the original calling party number to the twinned phone in the SIP From header (not the associated desk phone number) for calls that originate from an internal extension. On calls from the PSTN to a twinned phone, Avaya IP Office will send the calling party number of the host phone associated with the twinned destination (instead of the number of originating caller). This setting only affects twinning and does not impact the messaging of other redirected calls such as forwarded calls. If this box is checked, it will also override any setting of the **Send Caller ID** parameter on the SIP line (**Section 5.6**). On completion, click the **OK** button (not shown).

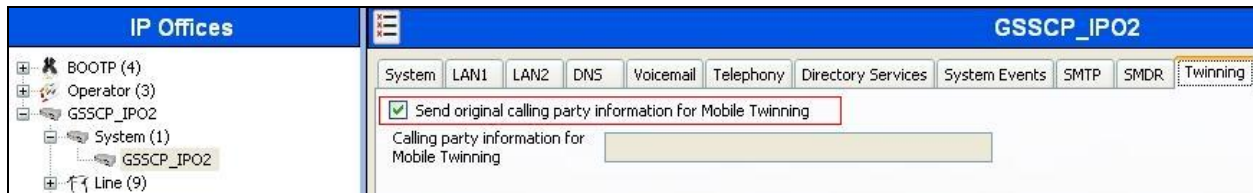

5.5. Codec Settings

Navigate to the **Codecs** tab on the Details Pane. Check the Available Codecs boxes as required. Note that **G.711 ULAW 64K** and **G.711 ALAW 64K** are greyed out and always available. Once available codecs are selected, they can be used or unused by using the horizontal arrows as required. Note that in test, **G.711 ALAW 64K**, **G.711 ULAW 64K** and **G.729(a) 8K CS-ACELP** were the supported codecs used for testing.

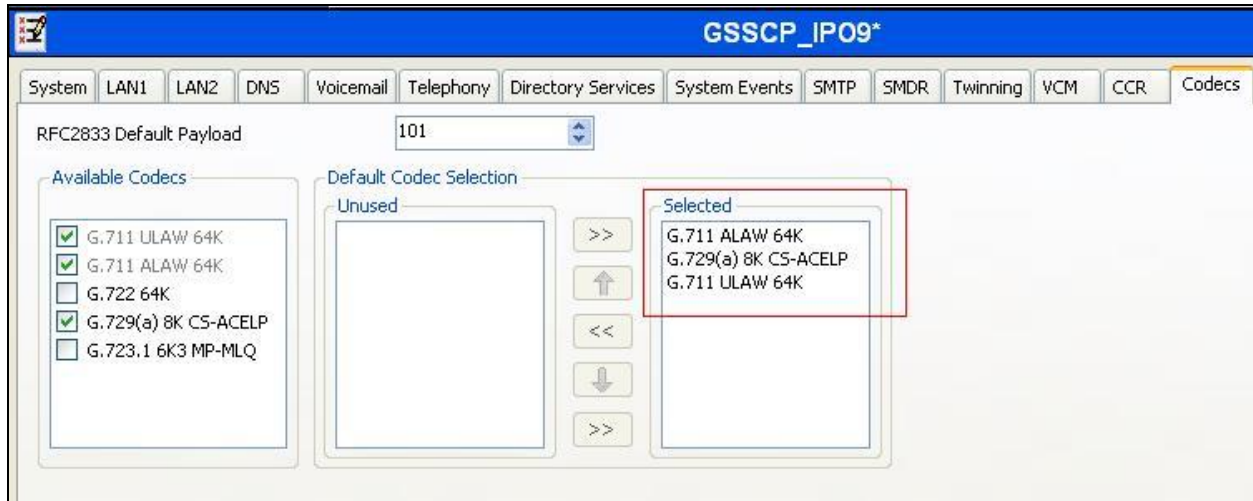

5.6. SIP Line

A SIP line is needed to establish the SIP connection between Avaya IP Office and the BT NOAS SIP Trunking service. The recommended method for configuring a SIP Line is to use the template associated with these Application Notes. The template is an .xml file that can be used by IP Office Manager to create a SIP Line. Follow the steps in **Section 5.6.1** to create the SIP Line from the template.

Some items relevant to a specific customer environment are not included in the template or may need to be updated after the SIP Line is created. Examples include the following:

- IP addresses
- SIP Credentials (if applicable)
- SIP URI entries
- Setting of the **Use Network Topology Info** field on the Transport tab.

Therefore, it is important that the SIP Line configuration be reviewed and updated if necessary after the SIP Line is created via the template. The resulting SIP Line data can be verified against the manual configuration shown in **Section 5.6.2**.


Also, the following SIP Line settings are not supported on Basic Edition:

- SIP Line – Originator number for forwarded and twinning calls
- Transport – Second Explicit DNS Server
- SIP Credentials – Registration Required


Alternatively, a SIP Line can be created manually. To do so, right-click **Line** in the Navigation Pane and select **New → SIP Line** (not shown). Then, follow the steps outlined in **Section 5.6.2**.

5.6.1. SIP Line From Template

1. Copy the template file to the computer where IP Office Manager is installed. Rename the template file to **IE_BTNOAS_SIPTrunk.xml**. The file name is important in locating the proper template file in **Step 5**.
2. Verify that template options are enabled in IP Office Manager. In IP Office Manager, navigate to **File → Preferences** (not shown). In the IP Office Manager Preferences window that appears, select the Visual Preferences tab. Verify that the box is checked next to **Enable Template Options**. Click **OK**.

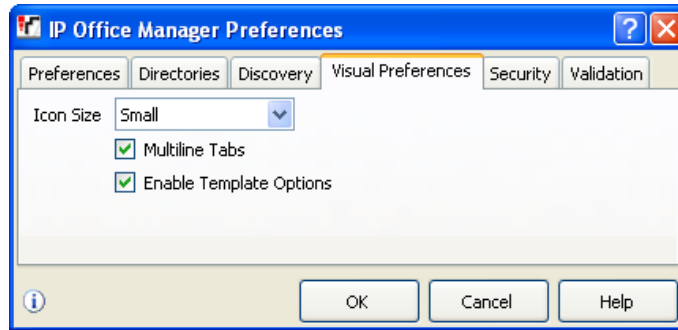


3. Import the template into IP Office Manager. From IP Office Manager, select **Tools** → **Import Templates in Manager**. This action will copy the template file into the IP Office template directory and make the template available in the IP Office Manager pull-down menus in **Step 5**. The default template location is **C:\Program Files\Avaya\IP Office\Manager\Templates**.

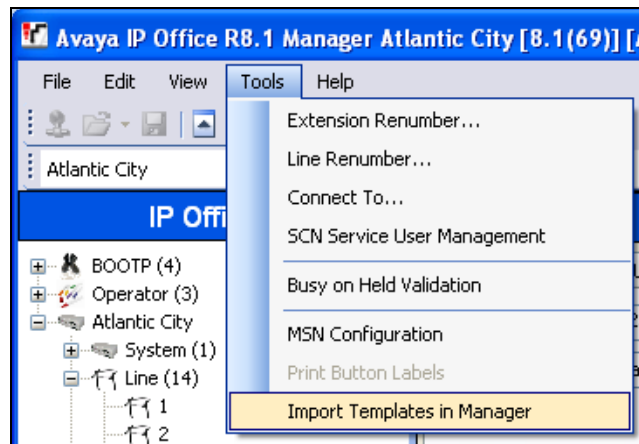


In the pop-up window (not shown) that appears, select the directory where the template file was copied in **Step 1**. After the import is complete, a final import status pop-up window (not shown) will appear stating success or failure. Click **OK** (not shown) to continue. If preferred, this step may be skipped if the template file is copied directly to the IP Office template directory.

- To create the SIP Trunk from the template, right-click on **Line** in the Navigation Pane, then navigate to **New** → **New SIP Trunk From Template**.

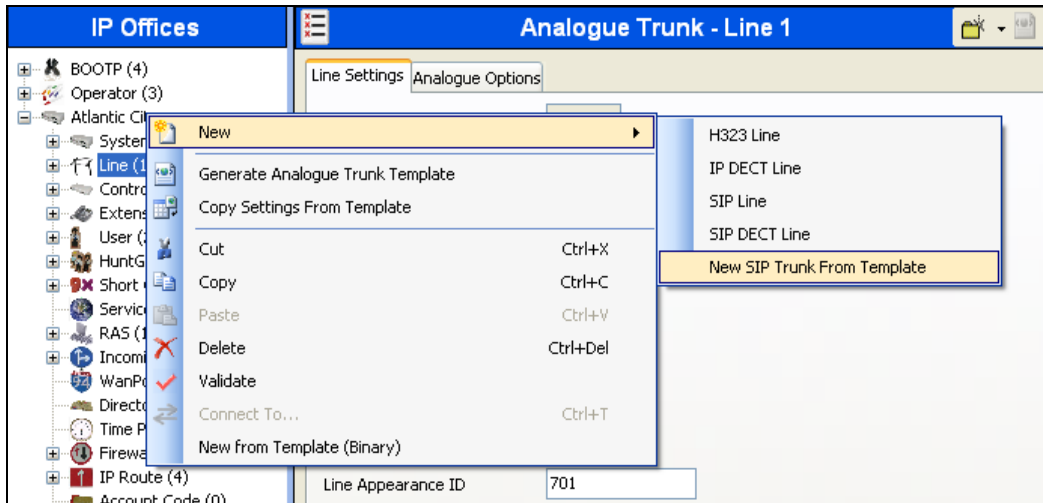

- In the subsequent Template Type Selection pop-up window, select **Ireland** from the **Country** pull-down menu and select **BT NOAS** from the **Service Provider** pull-down menu as shown below. These values correspond to parts of the file name (**IE_BTNOAS_SIPTrunk.xml**) created in **Step 1**. Click **Create new SIP Trunk** to finish creating the trunk.

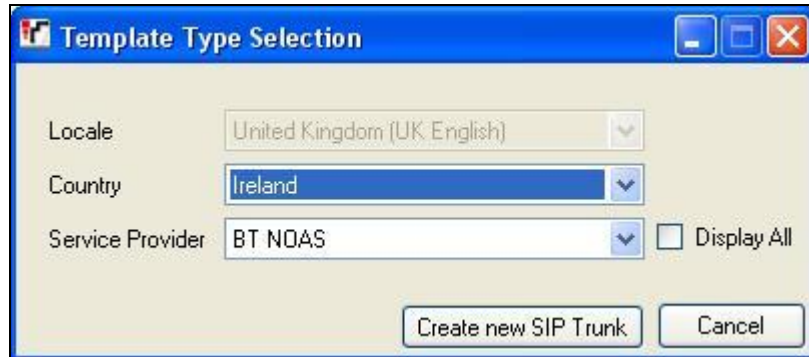

- Once the SIP Line is created, verify the configuration of the SIP Line with the configuration shown in **Section 5.6.2**.

5.6.2. SIP Line – SIP Line Tab

On the **SIP Line** tab in the Details Pane, configure the parameters below to connect to the SIP Trunking service.

- **ITSP Domain Name** field should remain blank as BT have not provided a Domain Name
- Set **Send Caller ID** to *None*
- Ensure the **In Service** box is checked
- Set **REFER Supported** to Auto
- Set **Method for Session Refresh** to **Reinvite**
- Default values may be used for all other parameters

On completion, click the **OK** button (not shown).

The screenshot displays the configuration page for 'SIP Line - Line 18'. The interface is divided into several sections. On the left, there are input fields for 'Line Number' (18), 'ITSP Domain Name' (empty), 'Prefix' (empty), 'National Prefix' (0), 'Country Code' (44), 'International Prefix' (00), 'Send Caller ID' (None), and 'Association Method' (By Source IP address). On the right, there are checkboxes for 'In Service' (checked) and 'Send From In Clear' (checked), and dropdown menus for 'URI Type' (SIP), 'Call Routing Method' (Request URI), 'Name Priority' (System Default), 'Service Busy Response' (486 - Busy Here), and 'Action on CAC Location Limit' (Allow Voicemail). At the bottom, there is a section for 'REFER Support' which is checked, with 'Incoming' and 'Outgoing' both set to 'Auto'. Below that, 'Method for Session Refresh' is set to 'Reinvite'.

Select the **Transport** tab and set the following:

- Set **ITSP Proxy Address** to the IP address of the BT NOAS SIP proxy
- Set **Layer 4 Protocol** to **UDP**
- Set **Send Port** to **5060** and **Listen Port** to **5060**
- Set **Network Topology Info** to **None**

On completion, click the OK button (not shown).

The screenshot shows the 'SIP Line - Line 18*' configuration window with the 'Transport' tab selected. The 'ITSP Proxy Address' field contains '192.168.31.71,192.168.31.72'. The 'Network Configuration' section includes: 'Layer 4 Protocol' set to 'UDP', 'Send Port' set to '5060', 'Use Network Topology Info' set to 'None', and 'Listen Port' set to '5060'. Below this, 'Explicit DNS Server(s)' are set to '0 . 0 . 0 . 0' and '0 . 0 . 0 . 0'. The 'Calls Route via Registrar' checkbox is checked. The 'Separate Registrar' field is empty.

After the SIP line parameters are defined, the SIP URIs that Avaya IP Office will accept on this line must be created. To create a SIP URI entry, first select the **SIP URI** tab. Click the **Add** button and the **New Channel** area will appear at the bottom of the pane.

The screenshot shows the 'SIP Line - Line 18' configuration window with the 'SIP URI' tab selected. A table with columns 'Channel', 'Groups', 'Via', 'Local URI', 'Contact', 'Display Name', 'PAI', 'Credential', and 'Max Calls' is visible. To the right of the table are three buttons: 'Add...', 'Remove', and 'Edit...'. The 'Add...' button is highlighted with a red box.

For the compliance test, a single SIP URI entry was created that matched any number assigned to an Avaya IP Office user. The entry was created with the parameters shown below.

- Set **Local URI** to **Use Internal Data**, this setting allows all calls on this line whose SIP URI matches the number set in the **SIP** tab of any User as shown in **Section 5.8**.
- Set **Contact**, **Display Name** and **PAI** to *.
- For **Registration**, select **0: <None>** from the pull-down menu since this configuration does not use SIP registration.
- Associate this line with an incoming line group by entering a line group number in the **Incoming Group** field. This line group number will be used in defining incoming call routes for this line. Similarly, associate the line to an outgoing line group using the **Outgoing Group** field. The outgoing line group number is used in defining short codes for routing outbound traffic to this line. For the compliance test, a new incoming and outgoing group **18** was defined that was associated to a single line (line 18).
- Set **Max Calls per Channel** to the number of simultaneous SIP calls that are allowed using this SIP URI pattern.

The screenshot shows the 'Edit Channel' configuration window. The fields are as follows:

Field	Value
Via	<None>
Local URI	Use Internal Data
Contact	*
Display Name	*
PAI	Use Internal Data
Registration	0: <None>
Incoming Group	18
Outgoing Group	18
Max Calls per Channel	10

Buttons: OK, Cancel

Select the **VoIP** tab, to set the Voice over Internet Protocol parameters of the SIP line. Set the parameters as shown below:

- Select **Custom** from the drop-down Codec Selection menu.
- Select **G.711 ALAW 64K, G.711 ULAW 64K and G.729(a) 8K CS-ACELP** codecs.
- Set the **DTMF Support** field to **RFC2833**. This directs Avaya IP Office to send DTMF tones using RTP events messages as defined in RFC2833.
- Uncheck the **VoIP Silence Suppression** box.
- Select the **Fax Transport Support** box to **T.38**.
- Check the **Re-invite Supported** box, to allow for codec re-negotiation in cases where the target of the incoming call or transfer does not support the codec originally negotiated on the trunk.
- Check **PRACK/100rel Supported** to advertise the support for provisional responses and Early Media to the BT NOAS network.
- Default values may be used for all other parameters.

The screenshot displays the configuration interface for a SIP Line, specifically Line 18. The interface is divided into several tabs: SIP Line, Transport, SIP URI, VoIP (selected), T38 Fax, and SIP Credentials. The VoIP tab contains the following settings:

- Codec Selection:** A dropdown menu is set to "Custom". Below it, there are two lists: "Unused" (containing G.722 64K) and "Selected" (containing G.711 ALAW 64K, G.729(a) 8K CS-ACELP, and G.711 ULAW 64K). Navigation buttons (>>, <<, <-, >-, <-, >-, >>) are positioned between the lists.
- Checkboxes:** On the right side, there are several checkboxes: "VoIP Silence Suppression" (unchecked), "Allow Direct Media Path" (unchecked), "Re-invite Supported" (checked), "Codec Lockdown" (unchecked), "PRACK/100rel Supported" (checked), "Force direct media with phones" (unchecked), and "G.711 Fax ECAN" (unchecked).
- Dropdowns and Text Fields:** "Fax Transport Support" is set to "T38", "Location" is set to "Cloud", "Call Initiation Timeout (s)" is set to "4", and "DTMF Support" is set to "RFC2833".

Select the **T.38 Fax** tab, to set the T.38 parameters for the line. Un-check the Use Default Values box (not shown) and select **2** from the **T38 Fax Version** drop down menu. Set the **Max Bit Rate (bps)** to **14400**. All other field may retain their default values. On completion, click the **OK** button (not shown).

The screenshot shows the configuration window for 'SIP Line - Line 18*'. The 'T38 Fax' tab is selected. The 'T38 Fax Version' dropdown is set to '2'. The 'Max Bit Rate (bps)' dropdown is set to '14400'. The 'Transport' dropdown is set to 'UDPTL'. The 'Redundancy' section has 'Low Speed' and 'High Speed' both set to '0'. The 'TCF Method' dropdown is set to 'Trans TCF'. The 'EFlag Start Timer (msecs)' is set to '2600', 'EFlag Stop Timer (msecs)' is set to '2300', and 'Tx Network Timeout (secs)' is set to '150'. On the right, the 'Scan Line Fix-up' and 'TFOP Enhancement' checkboxes are checked, while 'Disable T30 ECM', 'Disable EFlags For First DIS', 'Disable T30 MR Compression', and 'NSF Override' are unchecked. The 'Country Code' and 'Vendor Code' dropdowns are both set to '0'.

Note: It is advisable at this stage to save the configuration as described in **Section 5.11**.

5.7. Short Codes

Define a short code to route outbound traffic to the SIP line. To create a short code, right-click **Short Code** in the Navigation Pane and select **New** (not shown). On the **Short Code** tab in the Details Pane, configure the parameters as shown below.

- In the **Code** field, enter the dial string which will trigger this short code, followed by a semi-colon. The example shows **9N;**; which will be invoked when the user dials 9 followed by the dialed number.
- Set **Feature** to **Dial**. This is the action that the short code will perform.
- Set **Telephone Number** to **N** which will allow an IP Office user to dial the digit 9 followed by any telephone number, symbolized by the letter N. The **Telephone Number** field is used to construct the Request URI and To Header in the outgoing SIP INVITE message.
- Set the **Line Group Id** to the outgoing line group number defined on the SIP URI tab on the SIP Line in **Section 5.6.2**.

On completion, click the **OK** button (not shown).

The screenshot displays the IP Office configuration interface. On the left, a list of IP Offices is shown, with '9N;' selected. The main pane is titled '9N;; Dial' and contains the following configuration fields:

Field	Value
Code	9N;
Feature	Dial
Telephone Number	N
Line Group ID	18
Locale	
Force Account Code	<input type="checkbox"/>

The screenshot below displays an example of a short code ***67N;** that can be used to withhold the sending of the calling ID number. **W** is a Telephone Number Field Character used to withhold outgoing CLI. The short code is similar to the shortcode **9N;** code used to route outbound traffic to the SIP line except that the Telephone Number field begins with **W** which will withhold the sending of the calling ID number. **Note:** This operation is service provider dependent.

Short Code	
Code	*67N;
Feature	Dial
Telephone Number	WN
Line Group ID	18
Locale	
Force Account Code	<input type="checkbox"/>

5.8. User and Extensions


In this section, examples of IP Office Users, Extensions, and Hunt Groups will be illustrated. In the interests of brevity, not all users and extensions shown in **Figure 1** will be presented, since the configuration can be easily extrapolated to other users.

A new SIP extension may be added by right-clicking on **Extension** in the Navigation pane and selecting **New SIP Extension**. Alternatively, an existing SIP extension may be selected in the group pane. The following screen shows the **Extn** tab for the extension corresponding to an Avaya 1140E. The **Base Extension** field is populated with 89107, the extension assigned to the Avaya 1140E. Ensure the **Force Authorization** box is checked.



The screenshot shows the configuration page for SIP Extension 8003 89107. The 'Extn' tab is active. The 'Extension Id' field contains '8003' and the 'Base Extension' field contains '89107'. The 'Caller Display Type' is set to 'On'. The 'Reset Volume After Calls' checkbox is unchecked. The 'Device Type' is 'Avaya 1140E SIP'. The 'Location' is 'Automatic'. The 'Module' and 'Port' fields both contain '0'. The 'Force Authorization' checkbox is checked.

The following screen shows the **VoIP** tab for the extension. The **IP Address** field may be left blank or populated with a static IP address. Check the **Reserve Avaya IP endpoint license** box. The new **Codec Selection** parameter may retain the default setting “System Default” to follow the system configuration shown in **Section 5.5**. Alternatively, “Custom” may be selected to allow the codecs to be configured for this extension, using the arrow keys to select and order the codecs. Other fields may retain default values.

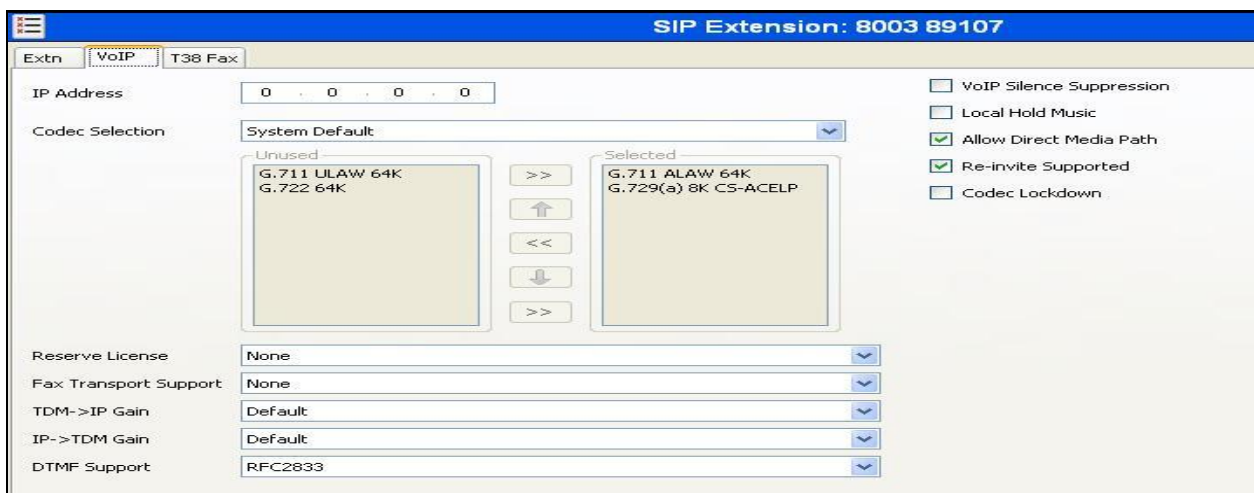

The screenshot shows the configuration page for SIP Extension 8003 89107, with the 'VoIP' tab active. The 'IP Address' field is empty. The 'Codec Selection' is set to 'System Default'. The 'Reserve License' dropdown is set to 'None'. The 'Fax Transport Support' dropdown is set to 'None'. The 'TDM->IP Gain' dropdown is set to 'Default'. The 'IP->TDM Gain' dropdown is set to 'Default'. The 'DTMF Support' dropdown is set to 'RFC2833'. The 'VoIP Silence Suppression' checkbox is unchecked. The 'Local Hold Music' checkbox is unchecked. The 'Allow Direct Media Path' checkbox is checked. The 'Re-Invite Supported' checkbox is checked. The 'Codec Lockdown' checkbox is unchecked. The 'Codec Selection' section shows two lists: 'Unused' (G.711 ULAW 64K, G.722 64K) and 'Selected' (G.711 ALAW 64K, G.729(a) 8K C5-ACELP).

To add a User, right click on **User** in the Navigation pane, and select **New**. To edit an existing User, select **User** in the Navigation pane, and select the appropriate user to be configured in the Group pane. Configure the SIP parameters for each User that will be placing and receiving calls via the SIP line defined in **Section 5.6**. To configure these settings, select the **User** tab if any changes are required. The example below shows the changes required to use Avaya 1140E which was used in test.

The screenshot shows the configuration page for a user named 'Extn89107: 89107*'. The interface includes a navigation bar with tabs for 'User', 'Voicemail', 'DND', 'Short Codes', 'Source Numbers', 'Telephony', 'Forwarding', 'Dial In', 'Voice Recording', and 'Button Programming'. The 'User' tab is active. The configuration fields are as follows:

Name	Extn89107
Password	*****
Confirm Password	*****
Account Status	Enabled
Full Name	Ext 89107
Extension	89107
Email Address	
Locale	
Priority	5
System Phone Rights	None
Profile	Power User

Below the profile dropdown, there are several checkboxes for additional features:

- Receptionist
- Enable Softphone
- Enable one-X Portal Services
- Enable one-X TeleCommuter
- Enable Remote Worker
- Enable Flare
- Enable Mobile VoIP Client

Select the **Telephony** tab. Then select the **Supervisor Settings** tab as shown below. The **Login Code** will be used by the Avaya 1140E telephone user as the login password.

Ext89107: 89107*

User Voicemail DND Short Codes Source Numbers **Telephony** Forwarding Dial In Voice Recording Button Programming

Call Settings **Supervisor Settings** Multi-line Options Call Log TUI

Login Code ***** Force Login

Login Idle Period (secs) Force Account Code

Monitor Group <None> Incoming Call Bar

Coverage Group <None> Outgoing Call Bar

Status on No-Answer Logged On (No change) Inhibit Off-Switch Forward/Transfer

Reset Longest Idle Time Can Intrude

All Calls Cannot be Intruded

External Incoming Can Trace Calls

After Call Work Time (secs) System Default (10) CCR Agent

Automatic After Call Work

Deny Auto Intercom Calls

Remaining in the **Telephony** tab for the user, select the **Call Settings** tab as shown below. Check the **Call Waiting On** box to allow multiple call appearances and transfer operations.

Ext89107: 89107*

User Voicemail DND Short Codes Source Numbers **Telephony** Forwarding Dial In Voice Recording Button Programming

Call Settings Supervisor Settings Multi-line Options Call Log TUI

Outside Call Sequence Default Ring **Call Waiting On**

Inside Call Sequence Default Ring Answer Call Waiting On Hold

Ringback Sequence Default Ring Busy On Held

No Answer Time (secs) System Default (15) Offhook Station

Wrap-up Time (secs) 2

Transfer Return Time (secs) Off

Call Cost Mark-Up 100

Next select the **SIP** tab in the Details Pane. To reach the **SIP** tab click the right arrow on the right hand side of the Details Pane until it becomes visible. The values entered for the **SIP Name** and **Contact** fields are used as the user part of the SIP URI in the From header for outgoing SIP trunk calls. These allow matching of the SIP URI for incoming calls without having to enter this number as an explicit SIP URI for the SIP line (**Section 5.6**). As such, these fields should be set to one of the DDI numbers assigned to the enterprise from BT.

In the example below, one of the DDI numbers in the test range is used, though only country code, city code and least significant digit are shown. The **SIP Display Name (Alias)** parameter can optionally be configured with a descriptive name. On completion, click the **OK** button (not shown).

Short Codes	Source Numbers	Telephony	Forwarding	Dial In	Voice Recording	Button Programming	Menu Programming	Mobility	Group Membership	Announcements	SIP	Personal Directory
SIP Name		055xxxxxxxx										
SIP Display Name (Alias)		055xxxxxxxx										
Contact		055xxxxxxxx										
<input type="checkbox"/> Anonymous												

5.9. Incoming Call Routing

An incoming call route maps an inbound DDI number on a specific line to an internal extension. To create an incoming call route, right-click **Incoming Call Routes** in the Navigation Pane and select **New**. On the **Standard** tab of the Details Pane, enter the parameters as shown below:

- Set the **Bearer Capacity** to **Any Voice**
- Set the **Line Group Id** to the incoming line group of the SIP line defined in **Section 5.6**
- Set the **Incoming Number** to the incoming number that this route should match on. Matching is right to left
- Default values can be used for all other fields

The screenshot shows the configuration form for an incoming call route. The top bar displays the number '18 055xxxxxxxxxxxx'. The 'Standard' tab is selected. The following fields are visible:

Bearer Capacity	Any Voice
Line Group ID	18
Incoming Number	055xxxxxxxxxxxx
Incoming Sub Address	
Incoming CLI	
Locale	
Priority	1 - Low
Tag	
Hold Music Source	System Source
Ring Tone Override	None

On the **Destinations** tab, select the destination extension from the pull-down menu of the **Destination** field. On completion, click the **OK** button (not shown). In this example, incoming calls to the test DDI number on line 18 are routed to extension 89107.

The screenshot shows the 'Destinations' tab of the configuration form. The top bar displays the number '18 055xxxxxxx'. The 'Destinations' tab is selected. The following table is visible:

TimeProfile	Destination
Default Value	89107 Extn89107


5.10. NoUserSourceNumber

NoUserSourceNumber is a string that is used to enter values in Avaya IP Office that have special uses.


During compliance testing it was observed that when BT NOAS initiates a call-hold, BT NOAS will send a reINVITE with the attribute “SendOnly” in the SDP. IP Office correctly responds with 200OK with the attribute “RecvOnly” in the SDP. However, once call-hold is initiated, RTCP packets are just sent in one direction from BT NOAS to Avaya IP Office. IP Office does not send RTCP packets when BT NOAS initiated call-hold using the Media attribute “SendOnly” in the SDP. BT NOAS expect to receive RTCP from IP Office and have 25 second RTCP timers configured on their SIP Media Gateway. As BT NOAS don’t receive any RTCP packets from IP Office, after 25 seconds, BT NOAS issue a BYE and the call is torn down. A fix has been provided in a custom build **IP Office 9.0.110.1**. With this build, it requires the configuration of a **NoUserSourceNumber (NUSN)** on IP Office.

The NUSN string consists of **SIP_LINE_NEAR_HOLD=N** where **N** is the active SIP Line number. With this NUSN string configured in IP Office, both RTP and RTCP packets are sent from IP Office to BT NOAS SIP trunk when on-hold resolving the call-hold issue. To configure IP Office to send both RTP and RTCP when on-hold, required by BTs SIP Trunk service, the following procedure may be used.

From the Navigation pane, select **User**. From the Group pane, scroll down past the configured users and select the user named **NoUser**. From the NoUser Details pane, select the tab **Source Numbers**. Press the **Add** button to the right of the list of any previously configured Source Numbers. In the **Source Number** field, type **SIP_LINE_NEAR_HOLD_=18**. Click **OK**. **Note: 18** is the active SIP Line number configured in **Section 5.6**.

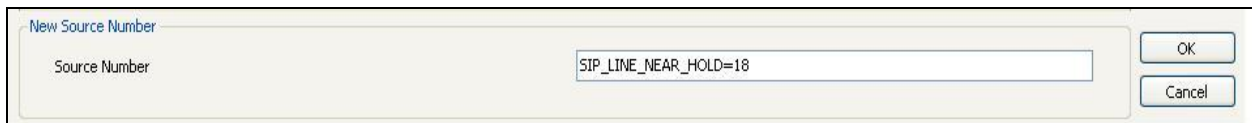

The source number **SIP_LINE_NEAR_HOLD_=18** should now appear in the list of Source Numbers as shown below.



5.11. Save Configuration

Navigate to **File → Save Configuration** in the menu bar at the top of the screen to save the configuration performed in the preceding sections.

6. BT NOAS SIP Trunk Service Configuration

BT is responsible for the configuration of the SIP Trunk Service. The customer will need to provide the public IP address used to reach the Avaya IP Office at the enterprise. BT will provide the customer the necessary information to configure the SIP connection to the SIP Trunking service including:

- IP address of SIP Trunking SIP proxy
- Network SIP Domain
- Supported codecs
- DDI numbers
- All IP addresses and port numbers used for signalling or media that will need access to the enterprise network through any security devices.


7. Verification Steps

This section includes steps that can be used to verify that the configuration has been done correctly.

7.1. SIP Trunk status

The status of the SIP trunk can be verified by opening the System Status application. This is found on the PC where IP Office Manager is installed in PC programs under **Start → All Programs → IP Office → System Status** (not shown).

Log in to IP Office System Status at the prompt using the **Control Unit IP Address** for the IP office. The **User Name** and **Password** are the same as those used for IP Office Manager.

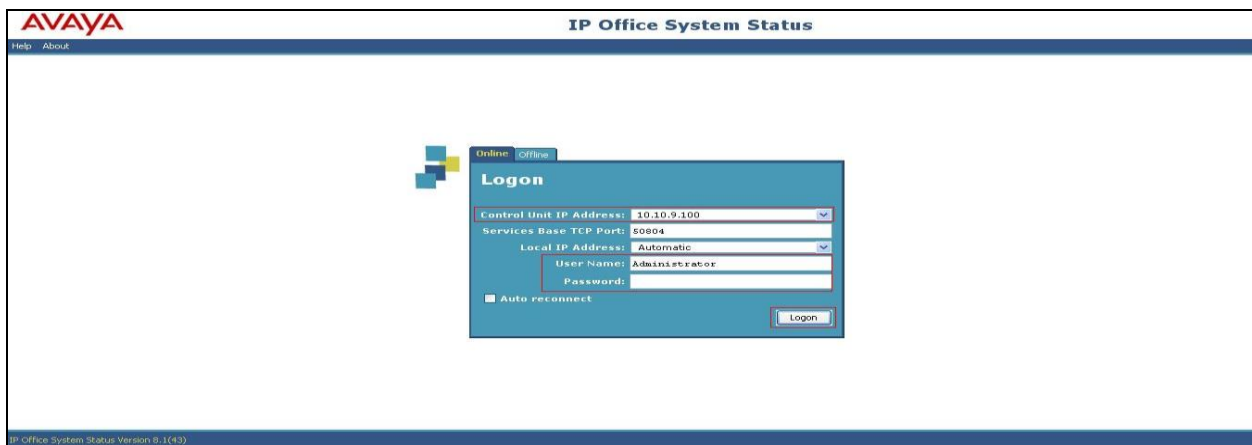

From the left hand menu expand **Trunks** and choose the SIP trunk (**18** in this instance). The status window will show the status as being idle and time in state if the Trunk is operational. IP address has been changed.

AVAYA **IP Office System Status**

Help Snapshot LogOff About

- System
- Alarms (7)
- Extensions (18)
- Trunks (9)
 - Line: 1
 - Line: 2
 - Lines: 5 - 8
 - Line: 9
 - Line: 10
 - Line: 18
- Active Calls
- Resources
- Voicemail
- IP Networking

Status
Utilization Summary
Alarms

SIP Trunk Summary

Peer Domain Name: sip://192.168.230.98
Resolved Address: 192.168.230.98
Line Number: 18
Number of Administered Channels: 10
Number of Channels in Use: 0
Administered Compression: G729 A, G711 A
Silence Suppression: Off
SIP Trunk Channel Licenses: Unlimited ● 0%
SIP Trunk Channel Licenses in Use: 0
SIP Device Features:

Channel Number	URI Gr...	Call Ref	Current State	Time in State	Remote Media Address	Codec	Connection Type	Caller ID or Dialed Digits	Other Party on Call
1			Idle	00:12:22					
2			Idle	00:12:11					
3			Idle	01:46:02					
4			Idle	01:46:02					
5			Idle	01:46:02					
6			Idle	01:46:02					
7			Idle	01:46:02					
8			Idle	01:46:02					
9			Idle	01:46:02					
10			Idle	01:46:02					

7.2. Monitor

The Monitor application can also be used to monitor and troubleshoot IP Office. Monitor can be accessed from **Start → Programs → IP Office → Monitor**. The application allows the monitored information to be customized. To customize, select the button that is third from the right in the screen below, or select **Filters → Trace Options**.

The following screen shows the **SIP** tab, allowing configuration of SIP monitoring. In this example, the **SIP Rx** and **SIP Tx** boxes are checked. All SIP messages will appear in the trace with the color blue. To customize the color, right-click on **SIP Rx** or **SIP Tx** and select the desired color.

All Settings

T1 | VComp | VPN | WAN | SCN | SSI | Jade
ATM | Call | DTE | EConf | Frame Relay | GOD | H.323 | Interface
ISDN | Key/Lamp | Directory | Media | PPP | R2 | Routing | Services | SIP | System

Events

Sip Low STUN SIP Dect


Packets

SIP Reg/Opt Rx SIP Misc Rx
 SIP Reg/Opt Tx SIP Misc Tx
 SIP Call Rx Cm Notify Rx
 SIP Call Tx Cm Notify Tx

Sip Rx hex IP Filter (nnn.nnn.nnn.nnn)
 Sip Tx hex

Default All Clear All Tab Clear All Tab Set All OK Cancel
Save File Load File Load Partial File Select File

As an example, the following shows a portion of the monitoring window for a Registration attempt to the SIP trunk.

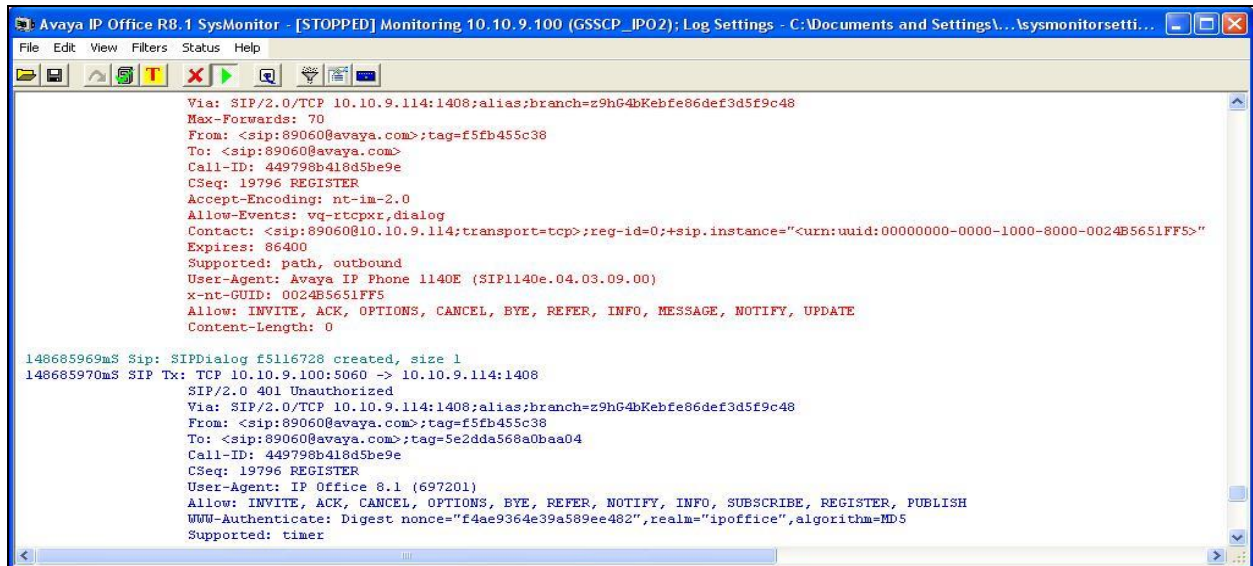

The screenshot shows a window titled "Avaya IP Office R8.1 SysMonitor - [STOPPED] Monitoring 10.10.9.100 (GSSCP_IPO2); Log Settings - C:\Documents and Settings\...\sysmonitorsetti...". The window contains a log of SIP messages. The first message is a REGISTER request from a SIP phone to a SIP trunk. The second message is a 401 Unauthorized response from the SIP trunk to the SIP phone, indicating that the registration attempt failed due to authentication issues.

```
Via: SIP/2.0/TCP 10.10.9.114:1408;alias;branch=z9hG4bKebfe86def3d5f9c48
Max-Forwards: 70
From: <sip:890608avaya.com>;tag=f5fb455c38
To: <sip:890608avaya.com>
Call-ID: 449798b418d5be9e
CSeq: 19796 REGISTER
Accept-Encoding: nt-im-2.0
Allow-Events: vg-rtcpnr,dialog
Contact: <sip:890608@10.10.9.114;transport=tcp>;reg-id=0;+sip.instance="urn:uuid:00000000-0000-1000-8000-0024b5651ff5"
Expires: 86400
Supported: path, outbound
User-Agent: Avaya IP Phone 1140E (SIP1140e.04.03.09.00)
x-nt-GUID: 0024b5651ff5
Allow: INVITE, ACK, OPTIONS, CANCEL, BYE, REFER, INFO, MESSAGE, NOTIFY, UPDATE
Content-Length: 0

148685969mS Sip: SIPDialog f5116728 created, size 1
148685970mS SIP Tx: TCP 10.10.9.100:5060 -> 10.10.9.114:1408
SIP/2.0 401 Unauthorized
Via: SIP/2.0/TCP 10.10.9.114:1408;alias;branch=z9hG4bKebfe86def3d5f9c48
From: <sip:890608avaya.com>;tag=f5fb455c38
To: <sip:890608avaya.com>;tag=5e2dda568a0baa04
Call-ID: 449798b418d5be9e
CSeq: 19796 REGISTER
User-Agent: IP Office 8.1 (697201)
Allow: INVITE, ACK, CANCEL, OPTIONS, EYE, REFER, NOTIFY, INFO, SUBSCRIBE, REGISTER, PUBLISH
WWW-Authenticate: Digest nonce="f4ae9364e39a589ee482",realm="ipoffice",algorithm=MD5
Supported: timer
```

8. Conclusion

These Application Notes describe the procedures required to configure the connectivity between Avaya IP Office and BT NOAS SIP Trunk solution as shown in **Figure 1**.

The reference configuration shown in these Application Notes is representative of a basic enterprise customer configuration and demonstrates Avaya IP Office can be configured to interoperate successfully with BT NOAS SIP Trunk Service. BT NOAS SIP Trunk Service is a SIP-based Voice over IP solution providing businesses a flexible, cost-saving alternative to traditional hardwired telephony trunks. The service was successfully tested with a number of observations listed in **Section 2.2**.

9. Additional References

Product documentation for Avaya products may be found at <http://support.avaya.com>.

- [1] *Avaya IP Office 8.1* Documentation CD, 16th July 2012.
- [2] *IP Office 8.1 Installation Manual*, Document Number 15-601042, August 2012.
- [3] *IP Office Manager Manual 10.0*, Document Number 15-601011, August 2012
- [4] *IP Office Release 8.1 Implementing Voicemail Pro*, Document Number 15-601064, June 2012
- [5] *System Status Application*, Document number 15-601758, 12th November 2011
- [6] *IP Office Softphone Installation*, 28th September 2011
- [7] *IP Office SIP Extension Installation*, 3rd October 2011
- [8] *Avaya IP Office Knowledgebase*, <http://marketingtools.avaya.com/knowledgebase>

©2014 Avaya Inc. All Rights Reserved.

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and ™ are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at devconnect@avaya.com.